

2016 CAT 335FLCR TRACK EXCAVATORS

INSPECTION DETAILS

Inspection Type	Marketing
Inspection Form	Standard
Inspection #	10174379
Inspection Status	Completed
Created	01/13/25 12:24:05
Updated	01/16/25 15:52:18
Created By	Garcia, Jr
Inspector	Garcia, Jr
Reviewers	Garcia, Jr
Salesperson	Schultis, Derrick R.
Stock #	E201797
Serial #	KNE00534
SMU / Hours	7,015
Location	Eloy, AZ 85131, United States



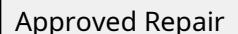
FEATURES

General


- Air Conditioner
- Coupler - Quick
- Hand and Foot Control
- Radio - AM FM Radio
- Boom - 1 Piece
- Coupler Type - Hydraulic
- Lighting
- Stick
- Car Body - Standard
- Engine Enclosures
- Mirrors
- Straight Travel Pedal

Regulatory

- Ultra Low Sulfur Diesel Fuel





CONDITION Good Fair Poor Approved Repair**GENERAL CONDITION**Body
Frame
General
ET Product Status Report
Download
YESLogged / Active Codes
NOVisible Oil Leaks
NO**GENERAL APPEARANCE**Bumper
Car Body
Counterweight


Has scratches

Crankcase Guard / Battery Box
Decals

Have scratchesDraw Bar
Eng. Enclose Hood / Stack
Engine Doors
Fenders
Right side fenders have dents on
bottom of fenderFiberglass
Fuel Tank
Grab Irons
Hood
Main Frame Welds
Paint


Has scratches

Plastic
Pre-Cleaner Bowl
Radiator Grill & Shroud
Sheet Metal
Steps / Ladder


Left front step is bent

Extra Fuel Tanks
NO

SAFETY ITEMS

Camera(s)


1 Horn


Seat Belt / Date

DEC 2024

Travel Alarm


ROPS
YES

ROPS Certification Plate
YES

1 Safety Decals In Place
YES

Safety Decals Legible
YES

OPERATOR STATION

Air Conditioner


1 Armrests


Dash Console


Door Latches / Hinges / Seals


Floor Boards / Mats

Floor mat is ripped.

3 Gauges


Headliner


Heater / Defroster


1 Hour Meter - GAUGES, OPERATION STATION, CONSOLE

Lower hour meter does not match display hour meter (display has same hours as status report)

Hydraulic Controls


Interior Lights


1 Interior Plastic / Fabric


Mirrors


Monitoring Display


Radio


Seat Cushions / Suspension /
Type

seat cover is not factory cat

 1 Switches

Horn switch is not legible and missing
switch plugs on right side console

 2 Travel Controls (Type)


Windows


Windshield Wipers


Current O&MM
YES

 1 Current Safety Manual
YES

 1

ENGINE

Belts / Pulleys - ENGINE


Engine Oil Level / Condition


Exhaust / Muffler / Stack


Fuel Injection System


Intake / Air Filters


 1 Operating Condition - ENGINE


Turbocharger / Blower


Apparent Other Engine Damage
NO

Blow By
NO

Emissions Decal Legible
NO

Fuel Leaks
NO

Knocking
NO

Oil Leaks
NO

Water in Oil
NO

EMISSIONS

Aftertreatment System Codes
NO

Leaks / Type
NO

COOLING SYSTEM

Anti-Freeze Level / Color /
Condition

Red

 1 Coolers


Fan


Fan Drive / Type



Fan Shrouds / Guards



Hoses / Tubes



Radiator



Water Pump



Compression in Radiator

NO

Coolant Leaks

NO

Oil in Anti-Freeze

NO

Standard Radiator

YES

ELECTRICAL, STARTING AND CHARGING SYSTEM

Alternator



Batteries / Cables / Master

Disconnect



Lighting



Starter



Wiring



HYDRAULICS

Boom Cylinder



Bucket Cylinder



Control Linkage



Hose Lines



Hydraulic Swivel



Operating Condition -

HYDRAULICS



Pump Drive



Pumps & Valves



Stick Cylinder



Swing Gear



Swing Motors



Tank



Travel Motors



ATTACHMENTS / WORK TOOLS

Auger
NO

Claw
NO

Crusher
NO

Grapple
NO

Hammer
NO

Pulverizer
NO

Rake
NO

Ripper
NO

Shear
NO

Thumb
NO

Tilting Ditch Bucket
NO

Vibratory Plate
NO

BOOM

Boom Condition

Boom Pins

Pins & Bushings - BOOM

Boom Length (Actual Length)
241"

STICK

Pins & Bushings - STICK

Stick Conditions

stick has dents (weld repair)

1 Stick Pins

Stick Length
126"

BUCKET

Bucket Bottom

Has dents

Bucket Mounts

Bucket Sides

Teeth / Adapters

Quick Coupler
YES

Brand
no tag on bucket

Notes - BUCKET
47inches

UNDERCARRIAGE

	Measurement (L)	% Worn (L)	Total Potential Hours (L)	Measurement (R)	% Worn (R)	Total Potential Hours (R)
Carrier Rollers Front	6.26	4		6.26	4	
Carrier Rollers Rear	6.26	4		6.26	4	
Idlers Front	0.84	21		0.84	21	
Links	4.84	14		4.78	35	
Pins & Bushings (External)	2.72	21		2.74	7	
Track Roller 1	0.72	5		0.74	5	
Track Roller 2	0.74	5		0.74	5	
Track Roller 3	guard			guard		
Track Roller 4	0.76	10		.74	5	
Track Roller 5	guard			guard		
Track Roller 6	0.76	10		0.78	15	
Track Roller 7	guard			guard		
Track Roller 8	0.74	5		0.76	10	
Track Roller 9	0.76	10		0.74	10	
Track Shoe Grouser Height	1.06	23		1.06	23	

Track Frame - Left


Track Frame - Right


Link Part Number
6y-2589

Links
multiple track links are seized on
left and right side

1 Track Shoes Width / Type
48 track pads are bent

1

FINAL DRIVES

Housings, Left



Housings, Right



Planetarys / Differential, Left



sprocket is worn

1

Planetarys / Differential, Right



sprocket is worn

Magnetic Plugs Removed &
Checked?

NO

MARKETING PHOTOS (30)











LINE ITEM PHOTOS (24)

Fenders



Right side fenders have dents
on bottom of fender



Steps / Ladder



Left front step is bent



Camera(s)



Seat Belt / Date

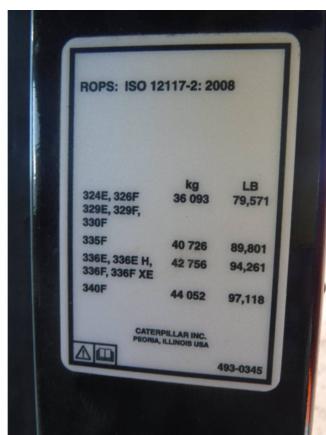


DEC 2024



ROPS Certification Plate

YES



Air Conditioner



Floor Boards / Mats



Floor mat is ripped.



Heater / Defroster



Hour Meter - GAUGES,

OPERATION STATION,

CONSOLE



Lower hour meter does not match display hour meter (display has same hours as status report)



Interior Lights



Seat Cushions / Suspension /

Type



seat cover is not factory cat



Switches



Horn switch is not legible and missing switch plugs on right side console



Current O&MM

YES



Current Safety Manual

YES



Intake / Air Filters



Anti-Freeze Level / Color / Condition

●●
Red



Stick Conditions

●●

stick has dents (weld repair)



Links

multiple track links are seized
on left and right side



Track Shoes Width / Type

48 track pads are bent

