

2015 CAT 336FL TRACK EXCAVATORS

INSPECTION DETAILS

Inspection Type	Marketing
Inspection Form	Standard
Inspection #	10207700
Inspection Status	Completed
Created	06/06/25 11:39:19
Updated	06/06/25 16:28:40
Created By	Garcia, Jr
Inspector	Garcia, Jr
Salesperson	Schultis, Derrick R.
Stock #	E204987
Serial #	RKB01541
SMU / Hours	8,729
Location	Eloy, AZ, United States



FEATURES

General


- Air Conditioner
- Coupler - Quick
- Hand and Foot Control
- Radio - AM FM Radio
- Boom - 1 Piece
- Coupler Type - Hydraulic
- Lighting
- Stick
- Car Body - Standard
- Engine Enclosures
- Mirrors
- Straight Travel Pedal

Regulatory

- Ultra Low Sulfur Diesel Fuel

Attachments

- Bucket

CONDITION Good Fair Poor Approved Repair**GENERAL CONDITION**Body
Frame
General
ET Product Status Report
Download
YESLogged / Active Codes
NOMachine Starts and is Operable
YESVisible Oil Leaks
NO**GENERAL APPEARANCE**Bumper
Car Body
Catwalk
Counterweight

Has scratches and dings 5 Crankcase Guard / Battery Box
Decals
Draw Bar
Eng. Enclose Hood / Stack
Engine Doors
Right rear pump compartment door
had light damage on lower cornerFenders
Fuel Tank
Grab Irons
Hood
Main Frame Welds
Paint


Slight scratches

Radiator Grill & Shroud
Sheet Metal
Steps / Ladder
**SAFETY ITEMS**

Camera(s)



1

Horn



Seat Belt / Date



May 2025

1

Travel Alarm



ROPS

YES

ROPS Certification Plate

YES

1

Safety Decals In Place

YES

Safety Decals Legible

YES

OPERATOR STATION

Air Conditioner



1

Armrests



Cab Filter / Heat Vent Louvres



Ambient Temp at 84° and Temp at
Vent 50°

Dash Console



Door Latches / Hinges / Seals



Floor Boards / Mats



Gauges



Headliner



Dirty. Part of wash

3

Heater / Defroster

1



Ambient Temp at 81° and Temp at
Vent 109°

Hour Meter - GAUGES,
OPERATION STATION, CONSOLE



Monitor hours do not match hour
meter.

1

Hydraulic Controls



Interior Lights



Interior Plastic / Fabric



Mirrors



Monitoring Display



Pans/Guards



Radio



Seat Cushions / Suspension /
Type



Stained with grease and oil

1

Switches



Travel Controls (Type)



Visor / Sunshade



Windows



Windshield Wipers



1

UPPER is Inoperable

Current O&MM

YES

Cover is damaged

2 Current Safety Manual

YES

ENGINE

Belts / Pulleys - ENGINE



Engine Oil Level / Condition



Engine Supports / Mounts



Exhaust / Muffler / Stack



Fuel Injection System



Governor



Intake / Air Filters



Operating Condition - ENGINE



Turbocharger / Blower



Blow By

NO

Fuel Leaks

NO

Knocking

NO

Oil Leaks

NO

Service Needed

YES

Water in Oil

NO

Oil Pressure (H/L/N)

Normal

Smoke Color (B/D/L/W)

Normal

EMISSIONS

Aftertreatment Heat Shields /

Guards



DEF Lines / Wiring



Diesel Exhaust Fluid (DEF) Tank



Diesel Particulate Filter (DPF)

Condition / Service Hours



Aftertreatment System Codes
NO

Leaks / Type
NO

COOLING SYSTEM

Anti-Freeze Level / Color /
Condition


Belts / Pulleys - COOLING
SYSTEM


Coolers


Fan


Fan Drive / Type


Fan Shrouds / Guards


Hoses / Tubes


Radiator


Water Pump


Compression in Radiator
NO

Coolant Leaks
NO

Oil in Anti-Freeze
NO

Standard Radiator
YES

ELECTRICAL, STARTING AND CHARGING SYSTEM

Alternator


Batteries / Cables / Master
Disconnect


Lighting




Starter


Wiring


Ether Aid
YES
With bottle



HYDRAULICS

Boom Cylinder




Bucket Cylinder


Control Linkage


Hose Lines


Hydraulic Swivel


Operating Condition -
HYDRAULICS


Pump Drive



Pumps & Valves



Rotex



Stick Cylinder



Swing Gear



Swing Motors



Tank



Travel Motors



BOOM

Boom Condition



Boom Pins



Pins & Bushings - BOOM



Boom Length (Actual Length)

21'4"

STICK

Pins & Bushings - STICK



Stick Conditions



Stick Pins



HAS LARGE DENT FROM BUCKET
EYELET.

Stick Length

12'10"

BUCKET

Bucket Bottom



Cracked on edges.



Bucket Linkage



Bucket Mounts



SLIGHT MOVEMENT AT ALL JOINTS

Bucket Sides



Teeth / Adapters



Quick Coupler

YES



Brand
Cat

Quick Coupler (Make/Model)
CAT

Width
41"

UNDERCARRIAGE

	Measurement (L)	% Worn (L)	Total Potential Hours (L)	Measurement (R)	% Worn (R)	Total Potential Hours (R)
Carrier Rollers Front	6.20	10		6.24	6	
Carrier Rollers Rear	6.24	6		6.20	10	
Idlers Front	.82	14		.84	21	
Links	4.82	21		4.82	21	
Pins & Bushings (External)	2.66	28		2.66	28	
Track Roller 1	.80	23		.82	30	
Track Roller 2	.78	15		.78	15	
Track Roller 3	GRD			GRD		
Track Roller 4	.78	15		.80	23	
Track Roller 5	GRD			GRD		
Track Roller 6	.80	23		.78	15	
Track Roller 7	GRD			GRD		
Track Roller 8	.80	23		.78	15	
Track Roller 9	.82	30		.82	30	
Track Shoe Grouser Height	1.04	23		1.04	23	

Track Frame - Left



Track Frame - Right



Cannon
GOOD

Link Part Number
6Y-2590/89

Track Shoes Width / Type
Has 10 bent pads on left and 6
on the right side

2

FINAL DRIVES

Housings, Left



Housings, Right


Planetaries / Differential, Left


Planetaries / Differential, Right


MARKETING PHOTOS (32)



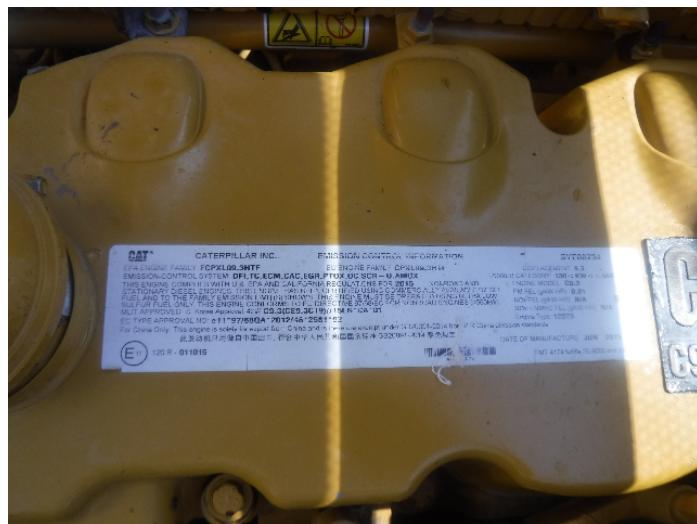











LINE ITEM PHOTOS (39)

Counterweight



Has scratches and dings

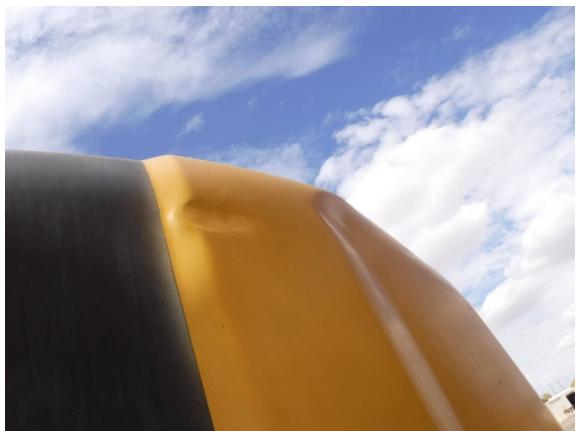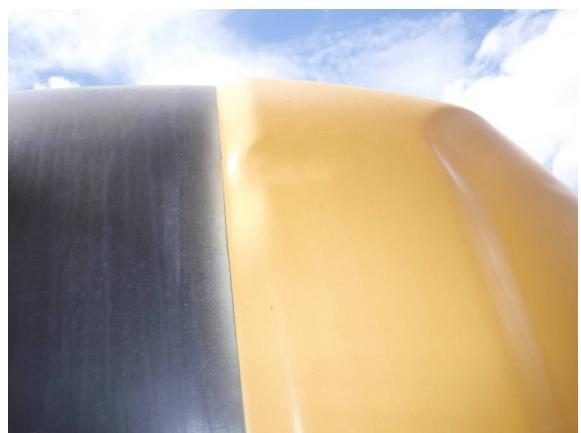

Engine Doors



Right rear pump compartment door had light damage on lower corner



Paint



Slight scratches



Camera(s)



Seat Belt / Date



May 2025



ROPS Certification Plate

YES



Air Conditioner



Ambient Temp at 84° and Temp
at Vent 50°



Headliner



Dirty. Part of wash



Heater / Defroster



Ambient Temp at 81° and Temp
at Vent 109°



Hour Meter - GAUGES,

OPERATION STATION,

CONSOLE



Monitor hours do not match
hour meter.



Seat Cushions / Suspension /

Type



Stained with grease and oil



Windshield Wipers




UPPER is Inoperable



Current O&MM

YES

Cover is damaged

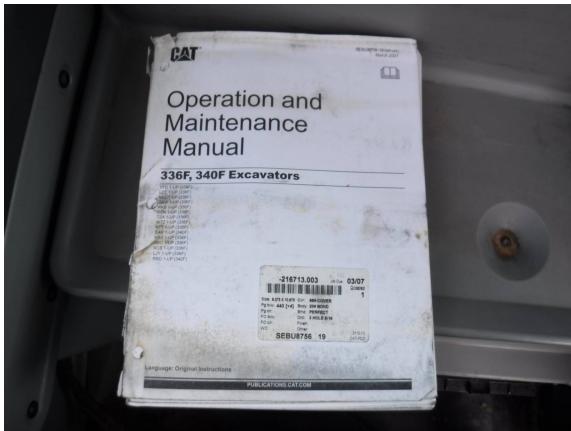

Lighting




Ether Aid

YES

With bottle



Boom Cylinder

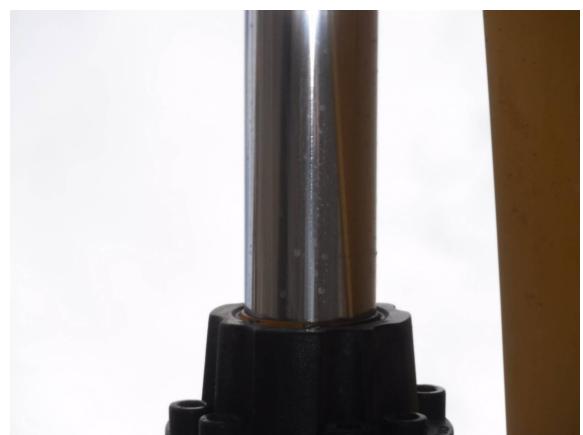

Stick Cylinder





Stick Conditions



HAS LARGE DENT FROM
BUCKET EYELET.



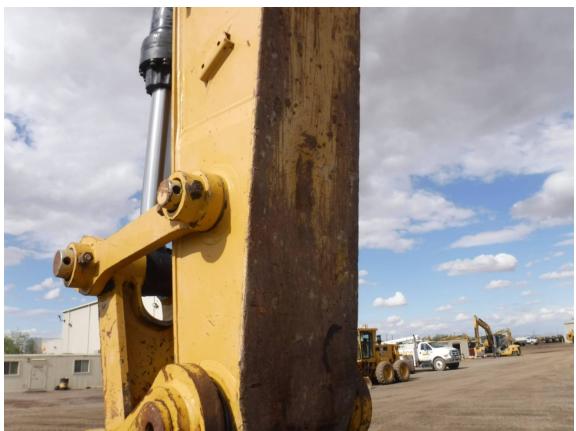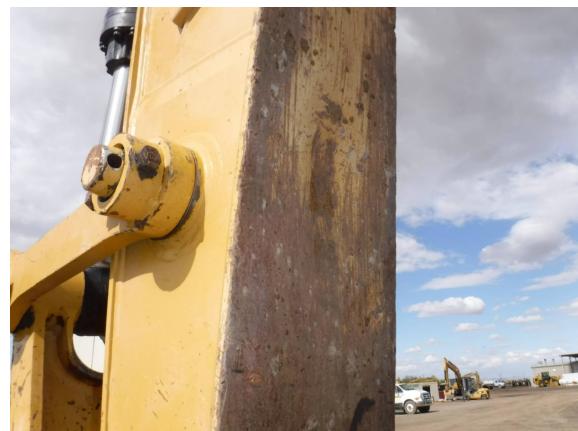

Bucket Bottom




Cracked on edges.



Bucket Linkage



SLIGHT MOVEMENT AT ALL
JOINTS

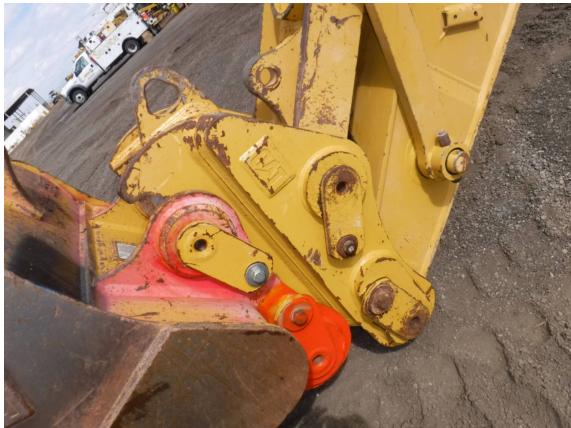

Quick Coupler

YES



Track Shoes Width / Type

Has 10 bent pads on left and 6
on the right side

