













Wheel Loader Inspection Report

Inspection Date: 4/29/2025

MACHINE DETAILS																																											
Manufacturer:JD	Model:844 P-TIER	S/N:1DW844PALPLX06955																																									
Year:2023	Eng S/N:	Trans S/N:																																									
SMU/Hrs:13066	Hours Date:4/29/2025																																										
Last Schedule:	Last CTS:	Last PM:4/18/2025																																									
Date Oil Sample Sent to Lab:4/30/2025	Oil Sample:ENG TRANS																																										
Recommendations:																																											
WHEEL LOADER CONFIGURATION																																											
Machine rebuild: No	Rebuild type:	Machine rebuild hours:																																									
ECM Download: No	ROPS: Enclosed	Product Link: Inquire for options on																																									
EROPS: Yes	OROPS: No	Air Conditioning: Yes																																									
Heater: Yes	Counterweight: Yes	Coupler, Quick: No																																									
Bucket: Yes	Bucket Size: 8.0 CYD	Edge: Yes																																									
Teeth: No	C/E or Teeth: EDGE	Auxiliary Hydraulics: No																																									
Boom Group: STD	Engine Tier Rating: T4F	High Lift: No																																									
Stick Steer: No	Ride Control: Yes	Fast Fill: No																																									
Auto Shift: Yes	Oil Change System: No	Anti-Theft System: No																																									
Product Link: No	Supplemental Steer: No	Weight System: No																																									
Tire Size: 875/65R29	Comment: JOYSTICK STEER																																										
GENERAL APPEARANCE																																											
CODE	REMARKS																																										
Radiator Grill	Good																																										
Shroud	Good																																										
Engine Enclosure	Good																																										
Hood / Stack	Good																																										
Fuel Tank	Good																																										
Fenders	Good																																										
Crankcase Guard	Good																																										
Battery Box	Good																																										
Front Frame	Good																																										
Rear Frame	Good																																										
Diff Supports	Good																																										
Counterweight	Good																																										
Pre-Cleaner Bowl	Good																																										
Cab	Good																																										
Canopy	Good																																										
Steps / Ladder	Fair	REAR FRAME STEPS AND BELTS DAMAGED, LIGHT BENDING TO LADDERS.																																									
Grab Irons	Good																																										
Paint	Good																																										
Sheet Metal	Good																																										
Guards / Screens	Fair	REAR LADDER MUD GUARDS BROKE OFF, TOW PIN MISSING.																																									
SOS Taken	Yes	ENG TRANS																																									
Cleaning Required	Yes	WASH FOR TRANSPORT AND DELIVERY.																																									
Notes																																											
																																											
SAFETY ITEMS																																											
CODE	REMARKS																																										
Safety Decals In Place	Yes																																										
Safety Decals Legible	Yes																																										
Articulation Safety Bar	Good																																										
Horn	Good																																										
ROPS	Yes																																										
Notes																																											
																																											

Wheel Loader Inspection Report

GAUGES, OPERATOR STATION, CONSOLE		
	CODE	REMARKS
Dash Console	Good	
Hour Meter	Good	
Gauges	Good	
Switches	Good	
Wipers	Good	
Air Conditioner	Good	
Heater	Good	
Radio / Speakers	Good	
Interior Lights	Good	
Seat Cushions	Good	
Arm Rests	Good	
Floor Boards	Good	
EMS Panel / Warnings	Good	HORN CODE.
Doors	Good	
Door Latches	Good	
CMS Panel	Good	
Glass / Mirrors	Good	
Seat Belt	Poor	DOES NOT RETRACT FULLY.
Hydraulic Controls	Good	
Sound Proofing	Yes	
Back-up Alarm	No	
Parts Book	No	
Safety Manual	Yes	
O&MM	Yes	
Notes		



ENGINE

	CODE	REMARKS
Oil Leaks	Yes	SEEPS FROM FRONT ENGINE COVER AROUND IMPLEMENT PUMP, SEE HYD SECTION.
Blow By	No	
Knocking	No	
Compression In Radiator	No	
Water In Oil	No	
Fluid Levels OK?	Yes	
EPA Decal	Yes	
Anti-freeze Color	RED	
Oil Pressure (H/L/W)	NORMAL	
Smoke (B/D/L/W)	NORMAL	
Operating Condition	Good	
Turbocharger / Blower	Good	
Fuel Injection System	Good	
Governor	Good	
Engine Supports	Good	
Air Cleaners	Good	
Exhaust / Muffler	Good	
Belts / Pullys	Fair	BELTS NOISY.
Oil Filter Condition (Cut)	NI	
Notes		



TRANSMISSION

	CODE	REMARKS
Case	Good	
Seals	Good	
Torque Converter	Good	
Universal Joints	Good	

Wheel Loader Inspection Report

Temp / Pressure Guages	Good	
Drive Shaft	Good	
Lines / Fittings	Good	
Oil Filter Condition (Cut)	NI	
Cooler	Good	
Operating Condition	Good	
Transmission - Noisy	No	
Leaks	Yes	TRANSMISSION HAS WET DEBRIS, POSSIBLE FROM HYD TANK LINES LEAKING, NEEDS WASHED AND MONITORED.
Notes		









COOLING SYSTEM

	CODE	REMARKS
Radiator	Good	
Coolers	Good	
Hoses	Good	
Water Pump	Good	
Fan	Good	
Fan Drive	Good	
Leaks	No	
Notes		








BRAKES

	CODE	REMARKS
Type (Wet, Dry)	WET	
Drums / Rotors	MULTI-DISC	
Control Valve	Good	
Lines	Good	
Master Cylinder	Not Applicable	
Compressor	Not Applicable	
Brake Linkage	Good	
Pedal	Good	
Parking Brake	Good	
Hydraulic Pumps	Good	
Accumulators	Good	
Notes		



STEERING

	CODE	REMARKS
Steering Linkage	Good	
Articulation Pins & Bushings	Good	
Steering Cylinder	Fair	STEERING CYLINDERS BUSHINGS LOOSE.
Supplemental Steering	Good	
Pumps	Good	
Valves	Good	
Hand Metering Unit	Good	
Steering Wheel Tilt / Extend	Not Applicable	
Lines / Fittings	Good	
Notes		









FINAL DRIVES

	CODE	REMARKS
Wheel Lugs & Rims	Good	


Wheel Loader Inspection Report

Rear Final Drives	Good	
Rear Axle	Good	
Front Final Drives	Good	
Front Axle	Good	
Differentials	Good	
Oscillation	Good	
Trunnions	Good	
Leaks	No	
Notes		



HYDRAULICS

	CODE	REMARKS
Operating Condition	Good	
Tank	Good	
Pumps & Valves	Fair	IMPLEMENT PUMP OFF FRONT ENGINE COVER SEEPS, NEEDS THOROUGH WASH AND MONITORED FOR LEAKS.
Hose Lines	Fair	TANK LINES SEEPING DOWN ONTO TRANSMISSION.
Control Linkage	Good	
Bucket Kickouts	Good	
Lift Cylinders	Good	
Tilt Cylinders	Good	
Attachment Cylinder	Not Applicable	
Filter Condition (Cut)	NI	
Leaks	No	
Notes		



ELECTRICAL, STARTING AND CHARGING SYSTEM

	CODE	REMARKS
Batteries / Cables	Good	
Starter	Good	
Alternator	Good	
Wiring	Good	
Pre-Heater	NI	
Lighting	Fair	BEACON EMITS WEAK.
Ether Aid	No	
Block Heater	No	
Notes		



BUCKET

	CODE	REMARKS
Cutting Edges	Good	
Teeth / Adapters	Not Applicable	
Bucket Bottom	Good	
Bucket Sides	Good	
Bucket Spill Guard	Good	DENTS.
Bucket Linkage	Fair	BUCKET TILT LINKS BUSHINGS LOOSE.
Loader Pins & Bushings	Good	
Loader Frame	Good	
Segments	Good	
Quick Coupler	Not Applicable	
Bucket Floor	Good	
Multipurpose Cylinders	Not Applicable	
Bucket Capacity	8.0 CYD	
Bucket S/N	PXBUPLEM800113	
Notes		

Wheel Loader Inspection Report



ATTACHMENTS / WORK TOOLS

	CODE	REMARKS
Lift Boom	No	
Angle Broom	No	
Vibratory Compactor Plate	No	
Asphalt Cutter	No	
Hydraulic Sweeper	No	
Material Handling Arm	No	
Grapple	No	
Forks	No	
Other	No	
Other	No	
Notes	THIS SECTION DOES NOT APPLY.	

TIRES

	MAKE S/N	TREAD DEPTH 1/32"	% LIFE LEFT	RECAPPED	TREAD CUT/CHUNKS	SIDE CUTS SECTIONS
Right Front	BRIDGESTONE V-TRACTION / 186	55.00	92.00			
Right Rear	BRIDGESTONE V-TRACTION / 821	56.00	93.00			
Left Rear	BRIDGESTONE V-TRACTION / 188	55.00	92.00			
Left Front	BRIDGESTONE V-TRACTION / 185	54.00	90.00			
Tire Size	875/65R29					
Spare	No					
Average Life Left	91.67%					
Notes						
Tires Needed						




SERVICE

	CODE	REMARKS
Service Needed	NA	
		

GENERAL REPAIRS AND REMARKS

Repairs Needed: ARTICULATION CYLINDERS BUSHINGS, LADDER MUD GUARDS BROKE OFF, BUCKET TILT LINK BUSHINGS LOOSE, SEATBELT, REAR FRAME STEPS DAMAGED.
General comments: MACHINE IN GOOD CONDITION WITH REPAIRS NEEDED. SEEPS FROM IMPLEMENT PUMP OFF FRONT ENGINE COVER AND TRANSMISSION COMPARTMENT, NEEDS THOROUGH WASH AND MONITORED.

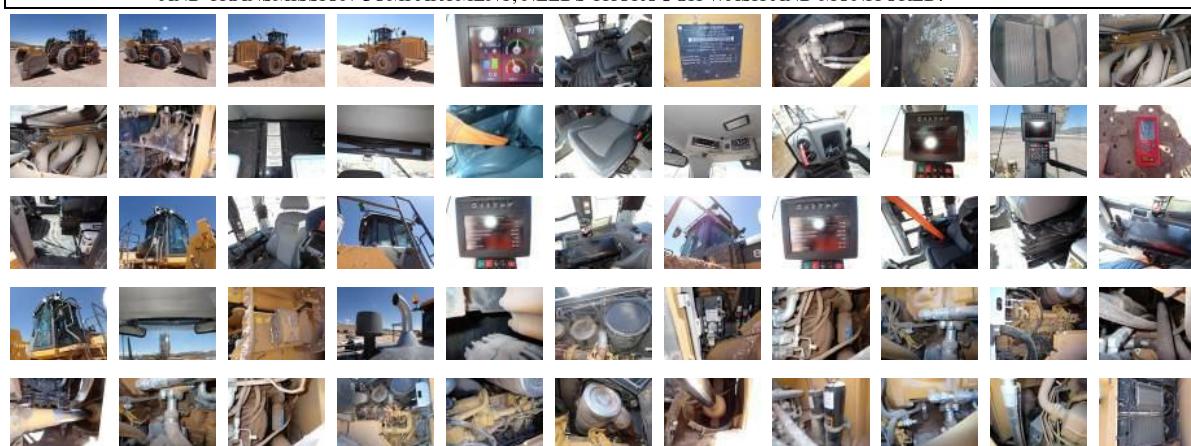

Wheel Loader Inspection Report

