

2023 CASE 575 BACKHOE LOADER

INSPECTION DETAILS

Inspection Type	Trade
Inspection Form	Standard
Inspection #	10255775
Inspection Status	Completed
Created	12/05/25 12:50:03
Updated	12/11/25 08:15:54
Created By	Preskitt, Billy
Inspector	Preskitt, Billy
Reviewers	Preskitt, Billy
Salesperson	Schultis, Derrick R.
Stock #	E211709
Serial #	NKJ0575NPNKH31409
SMU / Hours	591
Location	Eloy, AZ 85131, United States



FEATURES

General

- Controls, Joystick
- Lighting
- Steering - 2 Wheel
- Drive - 4 Wheel
- Rear Auxiliary Hydraulics
- Stick - Standard
- Engine Enclosures
- ROPS - Open

Regulatory

- Emissions Level
- Ultra Low Sulfur Diesel Fuel

Attachments

- Bucket - Rear
21"

CONDITION Good Fair Poor**Approved Repair****GENERAL CONDITION**Body
Frame
General


ET Product Status Report

Download

NO

non cat machine

Machine Starts and is Operable

YES

S.O.S. (All Compartments)

NOEngine hydraulic and
Transmission

Tires are Aired Up and Drivable

YES

VIDS/VIMS Download Available

NO

Visible Oil Leaks

NO**GENERAL APPEARANCE**Battery Box
 1Cab or Canopy
Counterweight
Battery box lid is missing a bolt and
latch is brokenDecals
 1Fenders
Fuel Tank


Decals on boom have scratches

 1Has dent on front side of tank (not
leaking)Grab Irons
Hood
 4Main Frame Welds
Paint

Has scratchesPlastic (Exterior)
Radiator Grill
Rubber Bumpers
 1Sheet Metal
Steps / Ladder
 2

Right side stepped has is slightly bent

Cleaning Required
YES

SAFETY ITEMS

Back Up Alarm



Horn



Safety Locks / Pins



Seat Belt / Date



No date on seat belt

Parking Brake Functioning

YES

ROPS

YES

ROPS Certification Plate



YES

Safety Decals In Place

YES

Safety Decals Legible

YES

Service Brakes Functioning

YES

OPERATOR STATION

Armrests



Dash Console



Gauges



gauge cover is missing bolts

Headliner



Hour Meter - GAUGES,
OPERATION STATION, CONSOLE



Hydraulic Controls



Interior Plastic / Fabric



Mirrors



Seat Cushions / Suspension /

Type



Switches



Switches are starting to fade

Transmission Controls



Current O&MM

NO

missing o&mm

Current Parts Manual

NO

Current Safety Manual

NO

missing safety manual

ENGINE

Belts / Pulleys - ENGINE



Engine Oil Level / Condition



Engine Supports / Mounts



Exhaust / Muffler / Stack



Fuel Injection System



Intake / Air Filters



part of service



Operating Condition - ENGINE



Turbocharger / Blower



Apparent Other Engine Damage

NO

Blow By

NO

Fuel Leaks

NO

Knocking

NO

Oil Leaks

YES



Water in Oil

NO

Oil pan gasket is wet. Valve on
top of valve cover is wet

COOLING SYSTEM

Anti-Freeze Level / Color /
Condition



Red



Coolers



Fan



Hoses / Tubes



Radiator



Water Pump



Compression in Radiator
NO

Coolant Leaks
NO

Oil in Anti-Freeze
NO

Standard Radiator
YES

ELECTRICAL, STARTING AND CHARGING SYSTEM

Alternator



Batteries / Cables / Master
Disconnect



Electrical Battery Box



Missing bolt



Jump Start Terminal



Starter



Wiring



Work Lights



Right rear work light not working

Signal Lights

6

YES

Right signal and marker light and right front signal lights not working

TRANSMISSION

Case



Controls



1

Lines / Fittings - TRANSMISSION



Operating Condition - TRANSMISSION



Seals



Temp / Pressure Gauges



Transmission - Forward Shifts



Transmission - Reverse Shifts



Leaks - TRANSMISSION

NO

Transmission - Noisy

NO

STEERING

Front Axle - STEERING



Hand Metering Unit



Lines / Fittings - STEERING



Steering Column / Tilt



Non tilt column

Steering Cylinder



Steering Linkage



Steering Operating Condition



Steering Pump



Tie Rods / Rod Ends



Wheel / Joystick



Wheel

BRAKE

Parking Brake Operation

●
Park brake does not hold. missing boot on park brake lever



Service Brake Operation



Leaks - BRAKE

NO

Notes - BRAKE

park brake does not hold in any gear

HYDRAULICS

Backhoe Control Valve



Boom Cylinder



Bucket & Hoist Kickout



Bucket Cylinder



Control Linkage



Hose Lines



Auxiliary lines on boom are smashed and bent

Lift Cylinders



Loader Valve



Out Rigger Cylinder



Both out rigger cylinders have nicks and scratches in the chrome

Pumps



Stick Cylinder



Swing Cylinder



Tank / Sight Glass / Cap



Tilt Cylinder



Leaks - HYDRAULICS

NO

ATTACHMENTS / WORK TOOLS

Asphalt Cutter

NO

Fork

NO

Hydraulic Hammer

NO

Hydraulic Sweeper
NO

Material Handling
NO

Vibratory Plate
NO

BOOM & STICK

Boom


Boom Pins & Bushings


Outriggers


 4

Both outrigger pads are torn

Stick


Stick Pins & Bushings


Swing Lock


Swing lock is missing

Swing Pivot


Transport Lock


 1

cable for transport lock casing is
peeling (functions as it should)

FRONT BUCKET

Bucket Bottom


 4

Bucket Floor


Bucket Sides


Cutting Edges


Loader Frame


Loader Pins & Bushings


Segments


Tilt Linkage


Front Bucket Quick Coupler
NO

Bucket SN # / Brand
No tag

Front Bucket Notes
87.5"

REAR BUCKET

Bucket Bottom - REAR BUCKET


Bucket Linkage


Bucket Mounts


Bucket Sides - REAR BUCKET

Left side of bucket has dent

**Teeth / Adapters - REAR BUCKET**

G.e.t is worn

Quick Coupler**NO****Bucket Width**

21"

Notes - REAR BUCKETBack of bucket by mounting area
is bent and torn

AXLES / FINAL DRIVES**Differential Supports****Differentials****Drive Shaft****Four Wheel Drive Operation****Front Axle****Front Final Drives****Rear Axle****Rear Final Drives****Trunion****Universal Joints****Wheel Lugs & Rims****Leaks****NO****Magnetic Plugs Removed &
Checked?****NO**

TIRES

	Make / Serial#	Tread Depth in 1/32"	% Life Remaining	Recapped	Tread Cuts/Chunks	Side Cuts Section
Left Front	Maxum	27	84	NO	YES	YES
Left Rear	Bkt	24	68	NO	YES	YES
Right Front	Bkt	13	37	NO	YES	YES
Right Rear	Bkt	24	68	NO	YES	YES

Spare
NO

Average Life Remaining - TIRES 64%	Front Tire Size 12.5/80-18	Rear Tire Size 16.9-28
---------------------------------------	-------------------------------	---------------------------

COMMENTS, MISC. REPAIRS, GENERAL REMARKS

comment 1
Service

comment 2
Inspection

MARKETING PHOTOS (31)











Case New Holland Construction Equipment
(India) Private Limited



MADE IN INDIA

Type / Model

LOADER BACKHOE

Product Identification Number (PIN)

AU010575PNKHS14008

LINE ITEM PHOTOS (48)

Battery Box



Battery box lid is missing a bolt
and latch is broken



Decals



Decals on boom have scratches



Fuel Tank



Has dent on front side of tank
(not leaking)




Hood



Hood is bent in front still function



Rubber Bumpers

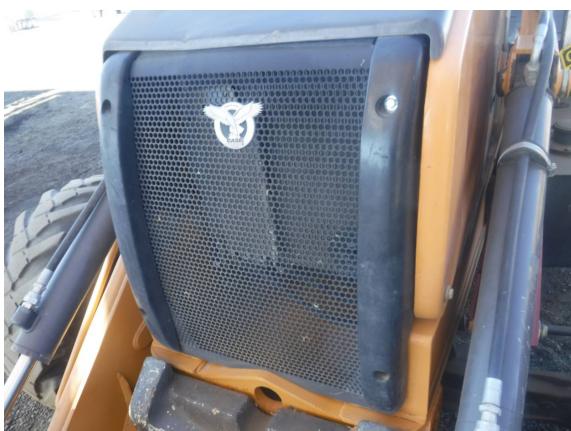

Steps / Ladder



Right side stepped has is slightly bent



Seat Belt / Date



No date on seat belt



ROPS Certification Plate

YES



Gauges



gauge cover is missing bolts



Interior Plastic / Fabric



Missing panel on left side
console and both locks are
damaged



Belts / Pulleys - ENGINE



Intake / Air Filters



part of service



Oil Leaks

YES

Oil pan gasket is wet. Valve on
top of valve cover is wet





Anti-Freeze Level / Color /

Condition



Red



Electrical Battery Box



Missing bolt



Work Lights



Right rear work light not working



Signal Lights

YES

Right signal and marker light and right front signal lights not working





Controls



boot is torn on fwd. and reverse handle



Parking Brake Operation



Park brake does not hold.
missing boot on park brake lever



Hose Lines



Auxiliary lines on boom are smashed and bent



Out Rigger Cylinder



Both out rigger cylinders have nicks and scratches in the chrome



Outriggers



Both outrigger pads are torn





Transport Lock



cable for transport lock casing
is peeling (functions as it
should)



Bucket Bottom





Bucket Sides - REAR BUCKET



Left side of bucket has dent



Teeth / Adapters - REAR BUCKET



G.e.t is worn



Notes - REAR BUCKET

Back of bucket by mounting
area is bent and torn

