

2020 950M WHEEL LOADER

INSPECTION DETAILS

Inspection Type	Trade
Inspection Form	Standard
Inspection #	10260989
Inspection Status	Completed
Created	01/02/26 12:52:51
Updated	01/06/26 15:25:23
Created By	Fuentes, David A.
Inspector	Fuentes, David A.
Reviewers	Fuentes, David A.
Salesperson	Schultis, Derrick R.
Transmission Serial #	TS401336
Engine Serial #	J7A08825
Serial #	J1S03549
SMU / Hours	4,285
Location	ELOY, AZ, United States



FEATURES

General

- Air Conditioner
- Counterweight
- Engine Enclosures
- Mirrors
- ROPS - Enclosed
- Auto Shift
- Coupler - Quick
- Lift - Standard
- Radio - AM FM CD Radio
- Steering Type - Wheel
- Boom, GP
- Coupler Type - Hydraulic
- Lighting
- Ride Control

Regulatory

- Emissions Level

Attachments

- Bucket

CONDITION

●●● Good

●● Fair

● Poor

Approved Repair

GENERAL CONDITIONBody
●●●Frame
●●●General
●●●ET Product Status Report
Download
YESLogged / Active Codes
NOMachine Starts and is Operable
YESTires are Aired Up and Drivable
YESVisible Oil Leaks
NO**GENERAL APPEARANCE**Bumper
●●●Cab or Canopy
●●●
CabCounterweight
●●●Crankcase Guard / Battery Box
●●●Decals
●●●Differential Supports
●●●Eng. Enclose Hood / Stack
●●●Fenders
●●●Front Frame
●●●Left front fender is slightly cracked
and bent (Functional)Fuel Tank
●●●Grab Irons
●●●Paint
●●●Pre-Cleaner Bowl
●●●Radiator Grill & Shroud
●●●Rear Frame
●●●Sheet Metal
●●●Steps / Ladder
●●●

Left rear cover is bent (Functional)

Right side missing step and straps.
Left rear step is bent

Cleaning Required
NO

SAFETY ITEMS

Back Up Alarm


Camera(s)


Horn


ROPS


Seat Belt / Date  1

Seat belts date tag are expired 11/20

Parking Brake Functioning
YES

ROPS Certification Plate
YES

Safety Decals In Place
YES

Safety Decals Legible
YES

Safety Locks / Pins
YES

Service Brakes Functioning
YES 

OPERATOR STATION

Air Conditioner  1

Vent temperature 54° Ambient
temperature 68° heater valve closed (Check pressors)

Armsrests


Cab Filter / Heat Vent Louvres


Dash Console


Door Latches / Hinges / Seals


Floor Boards / Mats


Gauges


Headliner


Heater / Defroster  1

Vent temperature 120° Ambient
temperature 70°

Hour Meter

4285 hours

Hydraulic Controls


Interior Lights


Interior Plastic / Fabric


Mirrors


Monitoring Display


Radio


Seat Cushions / Suspension /
Type

Air suspension

Switches


Transmission Controls


Windows


Windshield Wipers


Current O&MM
YES

1 Current Parts Manual
YES
CD

1 Current Safety Manual
YES



Sound Proofing
YES

Diesel Exhaust Fluid (DEF) Level
99%

Fuel Level
99%

ENGINE

Belts / Pulleys


Engine Oil Level / Condition


Engine Supports / Mounts


Exhaust / Muffler / Stack


Fuel Injection System


Governor


Intake / Air Filters


Operating Condition


Turbocharger / Blower


Apparent Other Engine Damage
NO

Blow By
NO

Emissions Decal Legible
NO

Fuel Leaks
NO

Has Engine been rebuilt?
NO

Knocking
NO

Oil Leaks
NO

Pre Lube System
NO

Service Needed
NO
64 hour on oil

Water in Oil
NO

Engine S/N
J7A08825

Notes - ENGINE
4285 Hours

1 Oil Pressure (H/L/N)
Normal

Smoke Color (B/D/L/W)
Normal

EMISSIONS

Aftertreatment Heat Shields /
Guards


DEF Lines / Wiring


Diesel Exhaust Fluid (DEF) Tank


Diesel Particulate Filter (DPF)
Condition / Service Hours


Aftertreatment System Codes
NO

Leaks / Type
NO

COOLING SYSTEM

Anti-Freeze Level / Color /
Condition

Red

Belts / Pulleys - COOLING
SYSTEM


Coolers


Fan


Fan Drive / Type


Fan Shrouds / Guards


Hoses / Tubes


Radiator


Water Pump


Compression in Radiator
NO

Coolant Leaks
NO

Oil in Anti-Freeze
NO

Standard Radiator
YES

ELECTRICAL, STARTING AND CHARGING SYSTEM

Alternator



Batteries / Cables / Master

Disconnect



Starter / Type



Electric

Wiring



Work Lights



Jump Start Terminal

YES

Signal Lights

YES

TRANSMISSION

Case



Controls - TRANSMISSION



Cooler



Drive Shaft



Leaks - TRANSMISSION



Lines / Fittings - TRANSMISSION



Operating Condition -
TRANSMISSION



Pump - TRANSMISSION



Seals



Temp / Pressure Gauges



Torque Converter -
TRANSMISSION



Transmission



Transmission - Forward Shifts



Universal Joints - TRANSMISSION



Mag Screens Checked

NO

Transmission - Noisy

NO

STEERING

Articulate P & B



Hand Metering Unit



Lines / Fittings - STEERING



Pumps



Steering Cylinder



Steering Linkage



Steering Valves / Pumps



Steering Wheel Tilt / Extend



Valves



BRAKE

Accumulator



Accumulators



Brake Drums / Rotors



Rotor park brake

Brake Linkage



Control Valve



Hydraulic Pumps



Leaks - BRAKE



Lines



Lines / Tubes



Parking Brake - BRAKE



Pedal



Pump - BRAKE



Type (Wet, Dry)



Wet

Holds In Park

YES

All

Leaks - BRAKE

NO

Holding What Gear?

All

HYDRAULICS

Bucket & Hoist Kickout



Control Linkage



Hose Lines



Hoses & Tubes - HYDRAULICS



Lift Cylinders



Overall Operating Condition



Pumps & Valves



Tank



Tilt Cylinder



BUCKET

Bucket Bottom



CAM 4

Bucket Floor



Bucket Linkage - BUCKET



Bucket P & B



Bucket Sides



Cutting Edges

CAM 2

Loader Frame



Loader Pins & Bushings



Quick Coupler



Standard Lift

YES

Bucket Capacity

4.75 yd

CAM 1

Bucket S/N - BUCKET

Z1A27742

FINAL DRIVES

Differentials



Front Axle



Oscillation



Rear Axle



Trunion



Wheel Lugs & Rims - FINAL

DRIVES



Leaks - FINAL DRIVES

NO

TIRES

	Make / Serial#	Tread Depth in 1/32"	% Life Remaining	Recapped	Tread Cuts/Chunks	Side Cuts Section
Left Front	Michelin	43	95.56	NO	NO	NO
Left Rear	Michelin	43	95.56	NO	NO	NO


Right Front	Michelin	43	95.56	NO	NO	NO
Right Rear	Michelin	43	95.56	NO	NO	

Spare
NO

Tire Size - TIRES
23.5R25 * L3 XHA2

MARKETING PHOTOS (26)



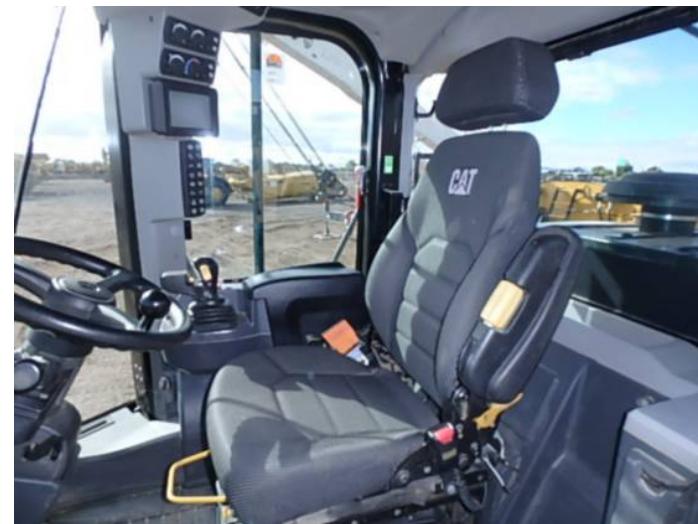








LINE ITEM PHOTOS (30)

Fenders



Left front fender is slightly cracked and bent (Functional)

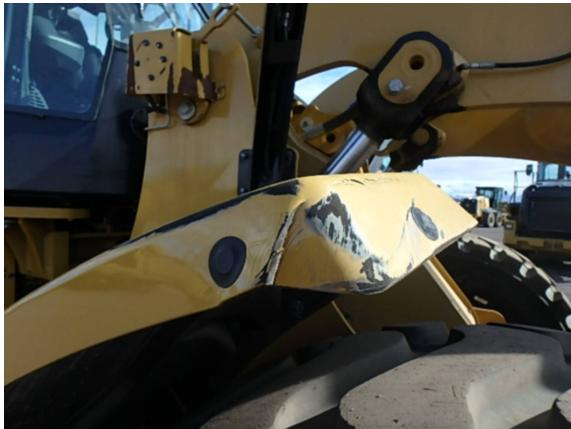

Sheet Metal



Left rear cover is bent (Functional)



Steps / Ladder



Right side missing step and straps. Left rear step is bent





Seat Belt / Date



Seat belts date tag are expired

11/20



Safety Decals In Place

YES



Safety Locks / Pins

YES



Air Conditioner



Vent temperature 54° Ambient
temperature 68° heater valve
closed (Check pressors)



Heater / Defroster




Vent temperature 120° Ambient
temperature 70°



Current O&MM

YES

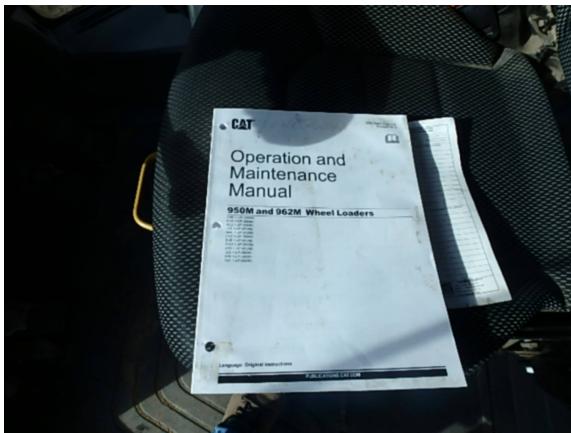

Current Parts Manual

YES

CD



Current Safety Manual

YES



Notes - ENGINE

4285 Hours



Bucket Bottom



Cutting Edges



Bucket Capacity

4.75 yd



Make / Serial#	Tread Depth in 1/32"	% Life Remaining	Recapped	Tread Cuts/Chunks	Side Cuts Section
Left Front	Michelin	43	95.56	NO	NO



Make / Serial#	Tread Depth in 1/32"	% Life Remaining	Recapped	Tread Cuts/Chunks	Side Cuts Section
Left Rear	Michelin	43	95.56	NO	NO
					
Right Front	Michelin	43	95.56	NO	NO
					
Right Rear	Michelin	43	95.56	NO	NO
					