

2020 CAT 14013 MOTOR GRADERS

INSPECTION DETAILS

Inspection Type	Marketing
Inspection Form	Standard
Inspection #	10187322
Inspection Status	Completed
Created	03/07/25 16:42:16
Updated	04/08/25 15:50:07
Created By	Calderas, Marco
Inspector	Calderas, Marco
Reviewers	Willis, Joseph
Salesperson	Schultis, Derrick R.
Stock #	E201803
Serial #	N9400352
SMU / Hours	5,266
Location	Eloy, AZ, United States



FEATURES

General


- Air Conditioner
- Differential Lock
- Lighting
- Product Link
- Ripper - Multi-Shank
- Throttle Lock
- Air Suspension Seat
- Drive - Tandem
- Mirrors
- Pushblock
- ROPS - Enclosed
- Defroster Fan
- Guard, Transmission
- Moldboard Size - 14'
- Radio - AM FM Radio
- Steering Type - Wheel

Regulatory

- Ultra Low Sulfur Diesel Fuel

MARKETING PHOTOS (31)



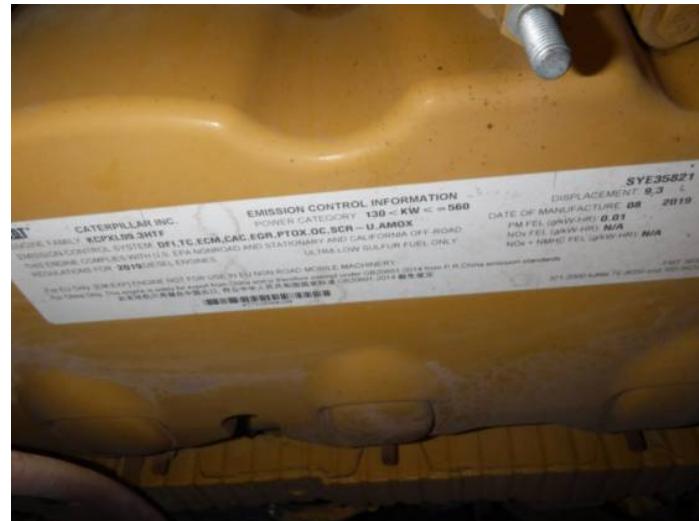









LINE ITEM PHOTOS (35)

Paint



Has scratches



Sheet Metal



Right side guard under cab is dented.



Steps / Ladder



Right side hanger bracket is bent.



Camera(s)




Seat Belt / Date

2025



ROPS Certification Plate

YES

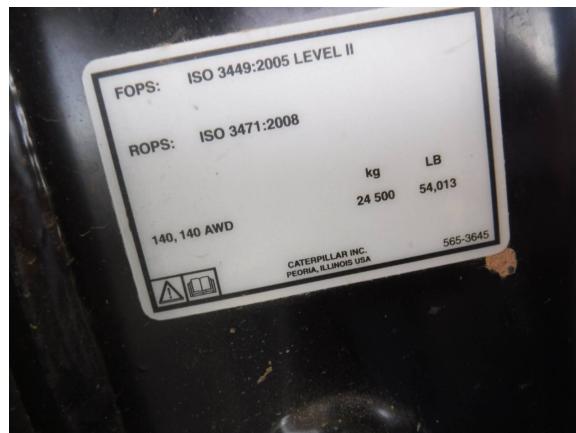

Air Conditioner



Ambient temp at 74.5F and

Vent temp at 47.8F



Heater / Defroster



Seat Cushions / Suspension /

Type



HAS SMALL HOLE



Windshield Wipers




Rear washers are inop.



Current O&MM

YES

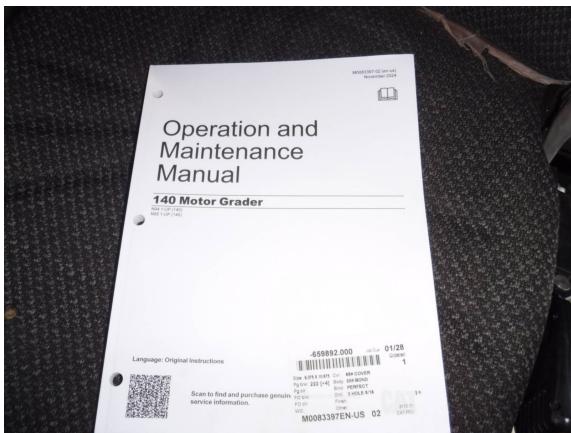

Current Safety Manual

YES



Cylinder Mounts / Pins



Has movement



Moldboard Tip Brackets /

Inserts



Slide brass worn



Tip Bracket Pivots / Bearings



Has movement in pins and
bushings



CYLINDER MOUNTS



Has movement at trunnions.



Make / Serial#	Tread Depth in 1/32"	% Life Remaining	Recapped	Tread Cuts/Chunks	Side Cuts Section
Left Center	YOKOHAMA	23	52	NO	YES



Make / Serial#	Tread Depth in 1/32"	% Life Remaining	Recapped	Tread Cuts/Chunks	Side Cuts Section
Left Front	YOKOHAMA	17	36	NO	YES
					
					
Left Rear	YOKOHAMA	26	58	NO	YES
					



Make / Serial#	Tread Depth in 1/32"	% Life Remaining	Recapped	Tread Cuts/Chunks	Side Cuts Section	
Right Center	YOKOHAMA	27	61	NO	YES	YES



Make / Serial#	Tread Depth in 1/32"	% Life Remaining	Recapped	Tread Cuts/Chunks	Side Cuts Section
Right Front	BRIDGESTONE	12	27	NO	YES
					
					
Make / Serial#	Tread Depth in 1/32"	% Life Remaining	Recapped	Tread Cuts/Chunks	Side Cuts Section
Right Rear	YOKOHAMA	26	58	NO	YES
					

